



File In Section: 08 - Body and Accessories

Bulletin No.: 05-08-64-002B

Date: April, 2006

Service Bulletin



TECHNICAL

Subject: Door Latch Freezing in Cold Temperatures (Apply Super Lube)

**Models: 2005-2007 GM Passenger Cars and Trucks (Including Saturn)
2003-2006 HUMMER H2
2006 HUMMER H3**

This bulletin is being revised to add models and model years. Please discard Corporate Bulletin Number 05-08-64-002A (Section 08 — Body and Accessories).

Condition


Some customers may comment on a door latch freezing due to ice accumulation in cold temperatures.

Cause

Water from a car wash or off the road may have entered the latch and frozen, causing the detent to move slowly. GM Super Lube® has been found to be an ideal solution to resolve latch freezing.

Correction

1. Verify that the striker properly engages the latch and that no obstructions are preventing the door from closing.

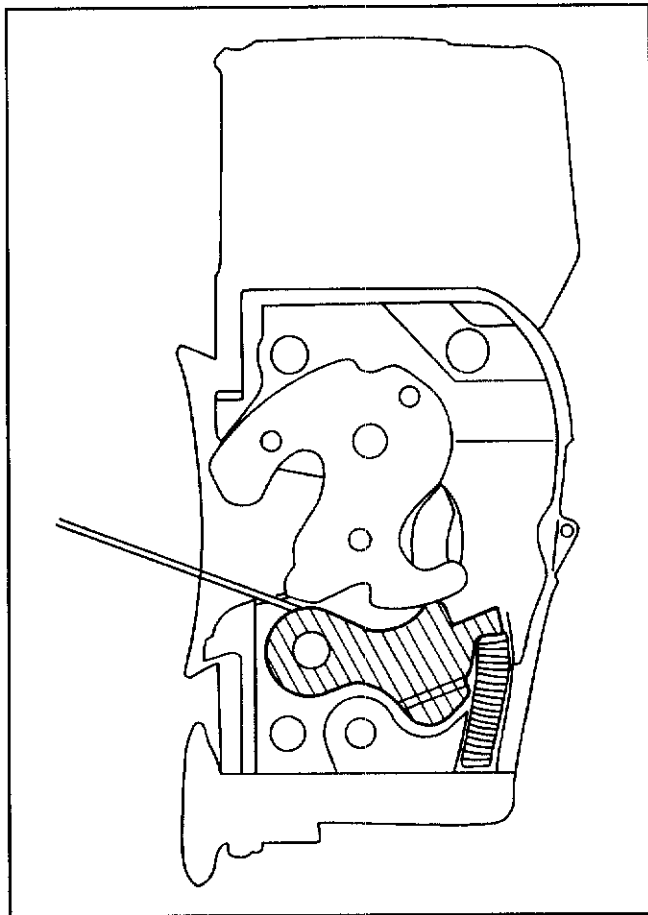

1580414

Important: The latch and its backing plate have been removed on the above illustration to show the location for the lube.

2. Allow the latch to completely thaw and apply compressed air for two seconds to the latch to force out any moisture. Refer to the above illustration (slashed area) for the location. Spray GM Super Lube® on BOTH sides of the latch detent lever for approximately two to three seconds. Refer to the above illustration (slashed area) for the lube location. Repeat for all door latches. Operate the door latch several times to spread the lubricant on all surfaces.

Parts Information

Part Number	Description
12346241	GM Super Lube
10953474	
(Canada)	

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
C9722*	Spray Latch Assemblies	0.2 hr
*This labor operation is for bulletin use only. It will not be published in the Labor Time Guide.		

